

- If necessary, use the arrow keys to select the desired standard value.




- When the reading is stable, the CFM tag starts blinking. Press CFM to confirm calibration.



- The instrument displays the “Stor” and “Good” messages and returns to measurement mode.

Notes:

- If the temperature is out of range, the “WRONG BUFFER TEMP” message blinks on the LCD.

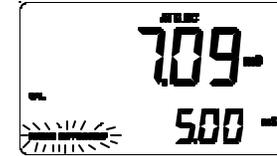

If the reading is too far from the expected value, “WRONG BUFFER” blinks.


- For best results choose a standard value for calibration close to the sample to be measured.
- During standard calibration the meter uses 1.90%/°C compensation coefficient . If the setup item “tc” has been set to different value, when exiting calibration mode, the displayed valued on the upper LCD might be different from the nominal standard value.

CUSTOM CALIBRATION

It is also possible to perform EC calibration with custom calibration solution.

- Immerse the probe in the custom calibration solution and select the EC range.

- Press CAL to enter the EC calibration and then the RANGE key to enter custom EC calibration mode.



- The “CAL”, “BUFFER” and “Cal Point Custom” tags light up. The primary LCD displays the not calibrated temperature compensated EC reading, while the secondary LCD shows the temperature compensated EC reading, factory calibrated with k=1. The hourglass symbol blinks.



- Using the arrow keys, adjust the EC reading on the primary LCD to the desired value.
- The maximum adjustment is $\pm 40\%$ around the secondary LCD reading.
- When the reading is stable, the CFM tag starts blinking on the LCD. Press CFM to confirm calibration.
- The instrument displays the “Stor” and “Good” messages and returns to measurement mode.




EC CALIBRATION

STANDARD CALIBRATION

EC calibration is a one-point procedure. Selectable calibration points are: 0.00, 84.0 and 1413 $\mu\text{S}/\text{cm}$, 5.00, 12.88, 80.0 and 111.8 mS/cm.

- Rinse the probe with calibration solution or deionized water, then immerse it into the solution. The sleeve holes must be completely submerged.
- Tap the probe repeatedly to remove any air bubbles that may be trapped inside the sleeve.
- To enter EC calibration, select the EC range and press CAL key.

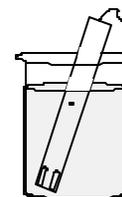

Note: TDS readings are automatically derived from the EC readings and no specific calibration for TDS is needed. Pressing CAL when TDS range is selected has no effect.

- For zero calibration, simply leave the dry probe in the air. The “CAL” and “BUFFER” tags light up.
- The primary LCD displays the not calibrated EC reading, while the secondary LCD shows one of the available standard values. The hourglass symbol blinks.

RELATIVE mV CALIBRATION

- Press CAL from the relative mV measurement mode. Absolute mV value is displayed on the primary LCD and the “Abs” message on the secondary LCD. 
- When the absolute reading is stable, the instrument asks for confirmation.
- If the reading is out of range, the “WRONG” tag will be displayed.
- Press CFM to confirm the absolute value. The instrument will display 0.0 mV on the primary LCD and “rEL” message on the secondary LCD. Now the relative mV offset is equal to the absolute mV reading.
- Use the arrow keys to change the displayed relative mV value.
- Press CFM to confirm the relative mV value. The relative mV offset is displayed on the primary LCD and “OFF” message on the secondary LCD for a few seconds. The instrument returns to measurement mode.

Note: The relative mV value can be changed only within the relative mV offset range (± 2000 mV).

Notes:

- Zero calibration is not allowed in custom mode.
- The calibrated custom value is considered the value of the calibration solution at the selected reference temperature.
- It is possible to set the cell constant value directly, without following the calibration procedure. To set the cell constant enter the setup mode and select the “CELL” item (see “Setup” section for details).
- The temperature reading is not used during custom EC calibration.

GOOD LABORATORY PRACTICE

GLP is a set of functions that allow data storage (and retrieval) about the electrode status and maintenance.

All data regarding pH, relative mV and EC calibrations are stored in the instrument memory.

CALIBRATION TIME-OUT ALARM

The instrument allows to set the number of days (from 1 to 7) before the next required pH calibration. The default setting is “OFF” (disabled).

At start-up the instrument checks if the calibration time-out has expired. If yes, the “CAL DUE” message blinks to advise the user that a new calibration is required.

Note: If the instrument was not calibrated or all calibration data were cleared, the “CAL DUE” message is displayed even if the feature is disabled in the setup menu.

LAST pH CALIBRATION DATA

The last pH calibration data are stored automatically after a successful calibration.

Notes:

- During calibration press RANGE key to toggle between pH buffer and temperature reading on the secondary LCD.
- Each time a buffer is confirmed, the new calibration parameters replace the old data of the corresponding buffer.
- To clear old calibration values, press “lock” before exiting calibration.



bration parameters and returns to measurement mode.

- Blinking “WRONG” tag and temperature value are displayed if the temperature reading is out of the defined temperature range for the buffer. Calibration cannot be confirmed in this situation.

TWO-POINT CALIBRATION

Proceed as described in the “Three-point calibration” section and press CAL after the second calibration point is accepted. The instrument will memorize the calibration data and return to normal measurement mode.

ONE-POINT CALIBRATION


Proceed as described in the “Three-point calibration” section and press CAL after the first calibration point is accepted. The instrument will memorize the calibration data and return to normal measurement mode.

To view the pH calibration data, from pH measurement mode press SHIFT and then GLP key. The instrument will display the date (yyyy.mm.dd) of last calibration.




Use the up arrow key to view all calibration parameters in the following sequence:

- Time (hh:mm) of the last calibration.

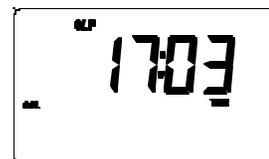



- pH calibration offset value.

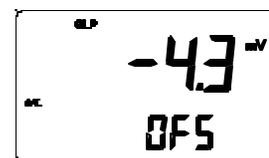

- pH calibration slope (the GLP slope is the average of the calibration slopes; the percentage is referred to the ideal value of 59.16 mV/pH).



- Calibration buffers in the order used for calibration, together with the corresponding warnings.

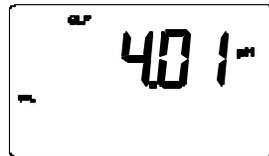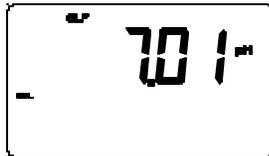

- The hourglass symbol will blink on the LCD until the reading is stable.
- When the reading is stable and close to the selected buffer, the CFM tag will blink.
- Press CFM to confirm calibration.
- The instrument stores the calibration values and returns to normal measurement mode.

Notes:

- If the measured value is not close to the selected buffer, the “WRONG” and “BUFFER” tags will blink. Check the buffer used or regenerate the electrode by following the pH electrode cleaning procedure described in the “Probe maintenance” section. If necessary, change the buffer or the electrode.
- Blinking “WRONG” & “BUFFER” tags and “Old” message on the secondary LCD, mean that inconsistency between new and previous (old) calibration is detected. Clear calibration parameters by pressing “lock” and proceed with calibration (the instrument will keep all confirmed values during the current calibration).
- If “lock” is pressed before the first calibration point is accepted, the instrument clears all cali-

- After the first calibration point is confirmed, immerse the pH electrode and the temperature probe approximately 4 cm into the second buffer solution and stir gently. The temperature probe should be close to the pH electrode.
- If necessary, use the arrow keys to select a different buffer value.
- The hourglass symbol will blink on the LCD until the reading is stable.
- When the reading is stable and close to the selected buffer, the CFM tag will blink.
- Press CFM to confirm. The calibrated value will be displayed on the primary LCD and the third expected buffer value on the secondary LCD.

Note: The instrument will automatically skip the buffers used for the first and second calibration points.

- After the second calibration point is confirmed, immerse the pH electrode and the temperature probe approximately 4 cm into the third expected buffer and stir gently. The temperature probe should be close to the pH electrode.
- If necessary, use the arrow keys to select a different buffer value.

Notes:


- The “OLD” message displayed beside a buffer value means that this buffer was not used during last calibration. Press SHIFT and then SETUP key to see the old calibration date (or time, if old calibration date is the same as the last procedure).
- Each buffer is displayed with the resolution used during calibration.
- The “no bUF” message means that calibration was performed at less than five points.



- Temperature compensation mode (ATC or MTC; with or without temperature probe).




- pH resolution during calibration.

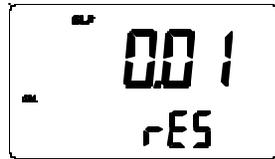

- Calibration time-out alarm status. The display shows “OFF” if the feature is disabled, or the days remaining before the calibration alarm will be activated (e.g. 5 days), or after the calibration is expired (e.g. -3 days).



- The instrument ID.

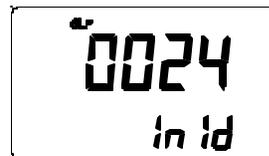

- If necessary, use the up and down arrow keys to select a different buffer value.
- The hourglass symbol will blink on the LCD until the reading is stable.
- When the reading is stable and close to the selected buffer, the CFM tag will blink.
- Press CFM to confirm calibration.



- The calibration value will be displayed on the primary LCD and the second expected buffer on the secondary LCD.



Note: The instrument will automatically skip the buffer used for the first point. It also skips 6.86 if 7.01 buffer was used and viceversa. Likewise, it will skip 9.18 if 10.01 buffer was used and viceversa.

PROCEDURE

5 memorized buffers are available for calibration: pH 4.01, 6.86, 7.01, 9.18 and 10.01.


For accurate measurements it is recommended to perform a three-point calibration. However, at least a two-point calibration is suggested.

Select pH range by pressing RANGE.




THREE-POINT CALIBRATION

- Immerse pH electrode and temperature probe approximately 4 cm into a buffer solution of your choice (pH 4.01, 6.86, 7.01, 9.18, or 10.01) and stir gently. The temperature probe should be close to the pH electrode.

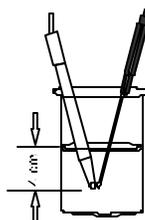

- Press CAL and the instrument will display the measured pH on the primary LCD and the "7.01" buffer on the secondary LCD, together with "CAL", "1" and "BUFFER" tags.

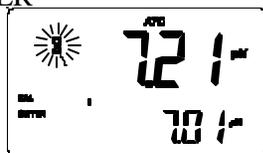


LAST Relative mV CALIBRATION DATA

Last relative mV calibration data are stored automatically after a successful calibration.

To view the relative mV calibration, from the relative mV measurement mode press and hold SHIFT and then GLP key.

The instrument will display the time (hh:mm) of the last calibration.

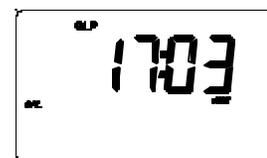

Use the up arrow key to view all logged calibration parameter in the following sequence:

- The date (yyyy.mm.dd).



- The Relative mV calibration offset.




- The instrument ID as in the pH GLP mode.

LAST EC CALIBRATION DATA

Last EC calibration data are stored automatically after a successful calibration.

To view the EC calibration data, from the EC measurement mode press and hold SHIFT and then GLP key. The instrument will display the time of last calibration.

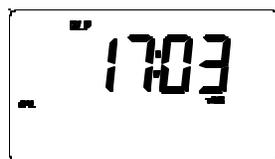

Use the up arrow key to view all logged calibration parameters in the following sequence:

pH CALIBRATION

It is recommended to calibrate the instrument frequently, especially if high accuracy is required.

The instrument should be recalibrated:

- whenever the pH electrode is replaced
- at least once a week
- after testing aggressive chemicals
- if CAL DUE tags are blinking during measurement

Always use fresh buffers for calibration and clean the electrode before starting the procedure (see “Probe maintenance” section).

PREPARATION

Pour small quantities of the buffer solutions into clean beakers.

For accurate calibration and to minimize cross-contamination, use two beakers for each buffer solution: one for rinsing the electrode and one for calibration.

If measurement will be taken in the acidic range, use pH 4.01 as second buffer, while for alkaline environment use pH 10.01 or 9.18 as second buffer.

AUTORANGING

The EC and TDS scales are autoranging. The meter automatically sets the scale with the highest possible resolution.

- By pressing the "lock" key, the autoranging feature is disabled and the current range is frozen on the LCD.



The "Auto" and "Off" (autoranging disabled) messages will be displayed on the LCD for a few seconds.


- To restore the autoranging option, press "lock" key again. The "Auto" and "On" (autoranging enable) messages will be displayed on the LCD for a few seconds.

Note: Autoranging is automatically restored if range is changed, if setup or calibration mode is entered and if meter is turned off and back on again.

- The date.



- Used calibration solution, standard.

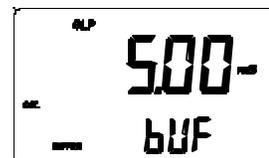

- Used calibration solution, custom.



- Cell constant.




- Calibration offset factor.



- Reference temperature.



- The temperature coefficient.

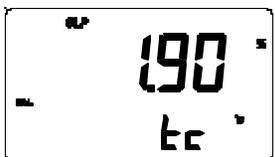

- The temperature compensation mode.



- The instrument ID as in the pH GLP mode.

- If “lock” was pressed to freeze the LCD range and the reading is out of range, the full-scale value of the frozen range will blink on LCD.

TEMPERATURE MEASUREMENTS

- To take the temperature measurements while the instrument is in pH or ORP range, connect the **A7662** temperature probe to the appropriate socket on the rear panel.

Immerse the temperature probe into the sample and allow the reading to stabilize.

- For EC and TDS ranges, the **A76309** probe is provided with a built-in temperature sensor.

Note: If the instrument is in pH or ORP range and **A7662** temperature probe is not connected, the °C tag will blink (manual compensation) even if the EC probe is connected.

changed, the temperature coefficient must be manually adjusted by the user.

For example, if α is the coefficient with reference temperature of 25°C, if changing the temperature to 20°C, the new coefficient can be calculated with the following formula:

$$\alpha = \alpha / (1 - \alpha / 20)$$

If $\alpha = 1.90\%/^{\circ}\text{C}$, then $\alpha = 2.10\%/^{\circ}\text{C}$.

- **Always set reference temperature to 25°C when measuring TDS.**

TDS MEASUREMENTS

- From EC range, press and hold first SHIFT and then MODE key. The instrument will switch to TDS measuring range.
- The TDS reading will be displayed on the primary LCD and the temperature reading on the secondary LCD.
- If the reading is out of range, the full-scale value (i.e. 99.9 ppt) will blink on display.



Notes:

- If NOTC is selected as temperature compensation mode during calibration, the temperature coefficient is not displayed in GLP.
- To return to measurement mode, press and hold SHIFT and then GLP key at any moment.
- If no calibration has been performed on the selected range, the “no CAL” message blinks on the display.

SETUP

Setup mode allows to view and modify the instrument parameters.

Depending on the selected range, it is possible to view and/or change specific range parameters and common parameters (for all ranges).


- Common parameters are: instrument ID, time and date.
- Range specific parameters are: calibration time-out alarm for the pH range; cell constant, TDS factor, temperature coefficient, reference temperature and temperature compensation for EC and TDS ranges.
- To enter the SETUP mode, press SETUP key from measurement mode. The instrument will display the first parameter of the specific range.
- Select the desired parameter using the arrow keys.
- Press CAL to change parameter value. The selected parameter will start blinking.
- Press RANGE to toggle between displayed parameters.
- Use the arrow keys to increase or decrease the displayed value.

3. **No compensation** (NOTC): the temperature is not taken into account. The reading displayed on the primary LCD is the actual EC or TDS value.

Notes:

- The default compensation mode is ATC.
- Temperature compensation setting can be accessed by entering the setup menu and selecting the “tcE” item (see “Setup” section for details).
- If no temperature probe is detected, ATC mode can not be selected and the instrument displays only dashes “----” on the secondary LCD.
- If the temperature compensation is active, measurements are compensated using the temperature coefficient (default value 1.90 %/°C).
To change the temperature coefficient, enter the setup mode and select the “tc” item (see “Setup” section for details).
- If the temperature reading is out of the 0.0 to 100.0°C interval and the ATC option is selected, the temperature full scale value will be displayed, together with the °C tag blinking. No temperature compensation will be performed.
- The reference temperature can be set from 15 to 30°C. When the reference temperature is

- Allow for the reading to stabilize. The primary LCD displays the measurement in the selected range, while the temperature is displayed on the secondary LCD.
- If the reading is out of range, the full-scale value (i.e. 199.9 mS) will blink.
- If “lock” was pressed to freeze the LCD range and the reading is out of range, the full-scale value of the frozen range will blink.

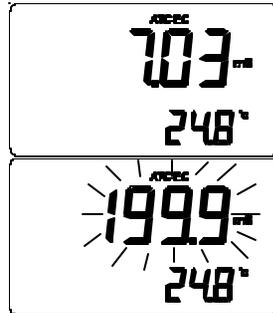

The EC reading is affected by temperature. Three options are available for temperature compensation:

1. **Automatic (ATC):** the EC probe features a built-in temperature sensor, which provides the temperature reading to automatically compensate the EC and TDS measurements (from 0.0 to 100.0°C), also using the selected reference temperature.
2. **Manual (MTC):** the temperature value can be manually set using the arrow keys. The compensation is referenced to the selected reference temperature. While in MTC mode, the °C tag blinks on the secondary LCD.

- Press CFM to save the modified value or CAL to escape without saving.
- Use the arrow keys to select the next/previous parameter.

SETTING COMMON PARAMETERS

Instrument ID

- Press CAL when the instrument ID is displayed. The instrument ID (0000 to 9999) will start blinking.



- Use the arrow keys to change the value.
- Press CFM to save the new instrument ID value, or CAL to escape without saving.

Current time

- Press CAL when the current time is displayed. The hour will start blinking.
- Use the arrow keys to change the hour.




- Press RANGE. The minutes will start blinking.
- Use the arrow keys to change the minutes.
- Press CFM to save the new value, or CAL to escape without saving.



Current date

- Press CAL when the current date is displayed. The year will start blinking.
- Use the arrow keys to change the year.
- Press RANGE. The month will start blinking.
- Use the arrow keys to change the month.
- Press RANGE. The day will start blinking.
- Use the arrow keys to change the day.
- Press CFM to save the modified value, or CAL to escape without saving.

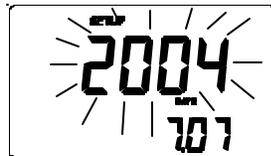

RELATIVE mV MEASUREMENTS

- To enter relative mV mode, from mV (ORP) range, press and hold first SHIFT and then MODE key.
- The relative mV reading will be displayed on the primary LCD and the current temperature value on the secondary LCD.



Note: The displayed relative mV reading is the difference between the current mV input value and the relative mV offset established in the relative mV calibration.

CONDUCTIVITY MEASUREMENTS

- Enter the conductivity (EC) measurement range by pressing the RANGE key.
- Immerse the probe into the solution to be tested. The sleeve holes must be completely submerged.
- Tap the probe repeatedly to remove any air bubble that may be trapped inside the sleeve.




ORP (mV) MEASUREMENTS

Oxidation-Reduction Potential (ORP) measurements provide the quantification of the oxidizing or reducing power of the tested sample.

To correctly perform a redox measurement, the surface of the ORP electrode must be clean and smooth.

- Press RANGE to enter mV range.
- Immerse the tip of the ORP electrode 4 cm into the sample to be tested and allow a few seconds for the reading to stabilize.
- The instrument displays the mV reading on the primary LCD and the temperature on the secondary LCD.

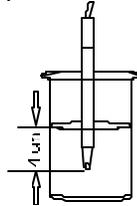

- If the reading is out of range, the closest full-scale value will blink on the primary LCD.



SETTING RANGE SPECIFIC PARAMETERS

pH Range

Calibration time-out alarm


- Press CAL when the calibration time-out is displayed. Calibration time-out value (OFF or 1 to 7 days) will start blinking.
- Use the arrow keys to change the value.
- Press CFM to save the new calibration time-out value, or CAL to escape without saving.



EC/TDS Range

Cell constant

- Press CAL when the cell constant is displayed. The cell constant value will start blinking.
- Use the arrow keys to change the cell constant (0.500 to 1.700).
- Press CFM to save the new cell constant value, or CAL to escape without saving.

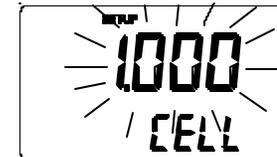


TDS factor

- Press CAL when the TDS factor is displayed. The TDS factor starts blinking.
- Use the arrow keys to change the TDS factor (0.40 to 1.00).
- Press CFM to save the modified value, or CAL to escape without saving.



Temperature compensation coefficient

- Press CAL when the temperature compensation coefficient is displayed. The temperature compensation value will start blinking.
- Use the arrow keys to change the coefficient (0.00 to 10.00 %/°C).
- Press CFM to save the new value, or CAL to escape without saving.

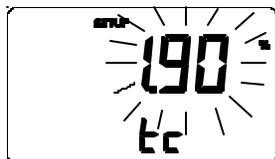

- If measurements are taken successively in different samples, it is recommended to rinse the electrode thoroughly with deionized or tap water and then with some of the next sample.
- The pH reading is affected by temperature. In order to measure the pH accurately, the temperature effect must be compensated for.



To use the ATC (Automatic Temperature Compensation) capability of the instrument, connect the **A7662** temperature probe, immerse it into the sample as close as possible to the pH electrode and wait for a few seconds.

- If the solution temperature is known, MTC (Manual Temperature Compensation) can be performed by disconnecting the temperature probe.

The display will show the default temperature of 25°C or the last temperature reading with the °C tag blinking.



- The temperature can be adjusted using the arrow keys (from -9.9°C to 120.0°C).




pH MEASUREMENTS

Make sure the instrument has been calibrated before taking pH measurements.


- Press RANGE to enter pH range.

Note: To change pH resolution press and hold first SHIFT and then MODE key.

- Immerse the electrode tip and the temperature probe approximately 4 cm into the sample to be tested and stir gently. Allow for the reading to stabilize.
- The pH value is displayed on the primary LCD and the temperature on the secondary LCD.

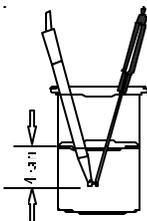

- If the pH reading is out of range, the closest full-scale value will blink on the primary LCD.

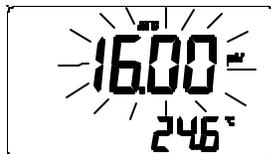

Reference temperature

- Press CAL when the reference temperature is displayed. The reference temperature value will start blinking.



- Use the arrow keys to change the reference temperature value (15 to 30°C).
- Press CFM to save the new value, or CAL to escape without saving.

Temperature compensation mode

- Press CAL when the temperature compensation is displayed. The temperature compensation mode will start blinking.
- Use the arrow keys to change the temperature compensation mode (Atc, Mtc or notc).
- Press CFM to save the new setting, or CAL to escape without saving.




HOLD FUNCTION


To freeze the first stable reading on the LCD, press the HOLD key from measurement mode (pH, mV or EC range).



The “Auto” and “H” tags will blink on the LCD until the reading is stabilized.

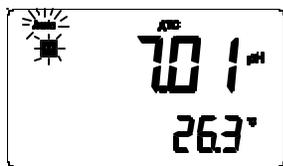

When the reading is stable, the “H” tag stops blinking and “Auto” tag turns off. The reading is frozen.

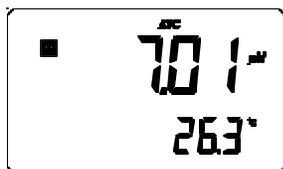

Press the HOLD key again to return the normal measurement mode.

INSTRUMENT START-UP

- Turn the instrument on by pressing the ON/OFF button.
- All LCD tags are displayed and a beep is generated while the instrument performs a self test.




Notes:

- The instrument starts in the same range and mode as it was at power off.
- The RANGE key toggles between pH, mV and EC ranges.
- The SHIFT and MODE keys change the displayed information for the selected range.

OPERATIONAL GUIDE

CONNECTIONS

- Plug the 12 Vdc adapter into the power supply socket.
- Note:** This instrument uses non volatile memory to retain the calibration parameters and all other settings even when unplugged.
- For pH or ORP measurements, connect the electrode to the BNC connector. For electrodes with separate reference, connect the reference electrode plug to the reference socket.
- For temperature measurements and automatic temperature compensation, connect the temperature probe to the appropriate socket.
- For EC and TDS measurements, connect the probe to the 7-pin connector. Tighten the threaded ring and make sure the probe sleeve is properly inserted.

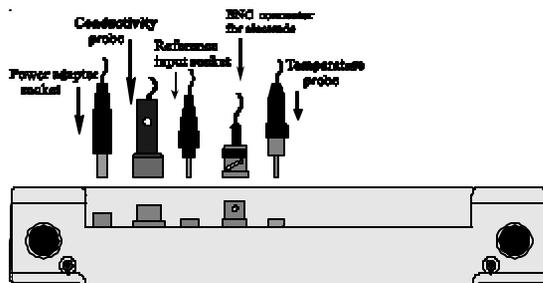

PROBE MAINTENANCE

pH ELECTRODE PREPARATION

Remove the electrode protective cap.
DO NOT BE ALARMED IF SALT DEPOSITS ARE PRESENT. This is normal with electrodes and they will disappear when rinsed with water.

During transport, tiny bubbles of air may form inside the glass bulb affecting proper functioning of the electrode. These bubbles can be removed by shaking down the electrode as you would do with a glass thermometer. If the bulb and/or junction is dry, soak the electrode in **A7071S** electrolyte solution for at least one hour.

For refillable electrodes:

If the filling solution (electrolyte) level is more than 2.5 cm below the fill hole, add **A7071S** electrolyte solution. For faster response, unscrew the fill hole screw during measurements.

pH ELECTRODE STORAGE

To minimize clogging and assure a quick response time, the glass bulb and the junction of the pH electrode should be kept moist and not allowed to dry out. Replace the solution in the protective cap with a few

drops of **A7071S** electrolyte solution.

Note: NEVER STORE THE ELECTRODE IN DISTILLED OR DEIONIZED WATER.

PERIODIC MAINTENANCE

Inspect the probe and cable. The cable used for connection to the instrument must be intact and there must be no points of broken insulation on the cable or cracks on the pH electrode stem or bulb.

Connectors must be perfectly clean and dry. If any scratches or cracks are present, replace the probe. For pH electrodes, rinse off any salt deposits with water.

For refillable electrodes:

Refill the electrode reference chamber with fresh **A7071S** electrolyte solution. Allow the electrode to stand upright for 1 hour. Follow the storage procedure.

pH ELECTRODE CLEANING PROCEDURE


Soak the electrode tip in deionized water for approximately 30 minutes.

IMPORTANT: After performing a cleaning procedure, rinse the electrode thoroughly with deionized water and soak it in **A7071S** electrolyte solution for at least 1 hour


1. Liquid Crystal Display (LCD)
2. **SETUP** key, to enter/exit setup mode
3. **CFM** key, to confirm values
4. **CAL** key, to enter/exit calibration mode
5. **Up arrow** key, to manually increase the value of temperature or other parameters
6. **Down arrow** key, to manually decrease the value of temperature or other parameters
7. **SHIFT** key, to activate the key alternate function (press and hold first the SHIFT key and then the second desired key)
8. **“lock”** key, to freeze current EC range on the LCD or to clear pH calibration parameter
9. **RANGE/MODE** key, to select measurement unit or switch the focused data and to select measurement mode or pH resolution
10. **ON/OFF** key, to turn the instrument ON and OFF
11. **HOLD/GLP** key, to freeze the first stable reading on the LCD and to display GLP information
12. Power supply socket
13. Conductivity probe connector
14. Reference input socket
15. BNC connector for pH or ORP electrode
16. Temperature probe socket

FRONT AND REAR PANELS

Front Panel

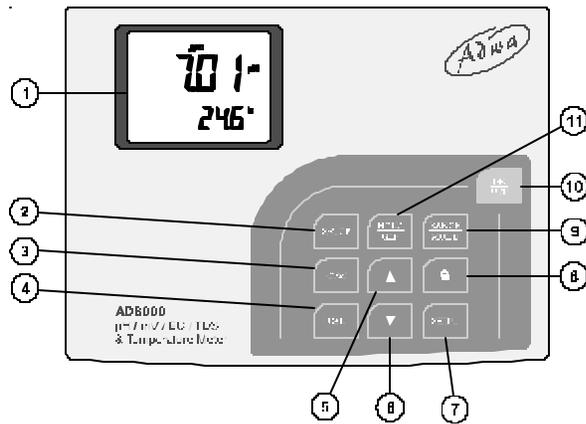

Rear Panel

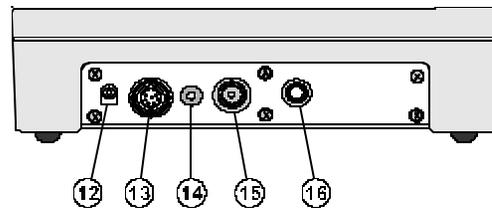


before taking measurements.

EC PROBE MAINTENANCE

After measurements, rinse the probe with clean water. If a more thorough cleaning is required, remove the probe sleeve and clean the probe with a cloth or a nonabrasive detergent.

Make sure to reinsert the sleeve onto the probe properly

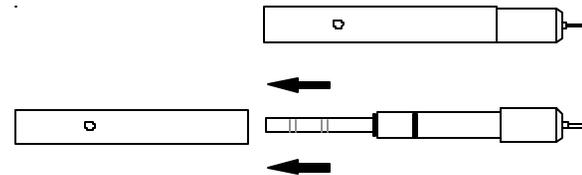

and in the right direction.

After cleaning the probe, recalibrate the instrument.

TROUBLESHOOTING GUIDE

SYMPTOM	PROBLEM	SOLUTION
Slow response/ excessive drift measuring pH.	Dirty pH electrode.	Soak the electrode tip in deionized water for 30 minutes and then clean the electrode.
Reading fluctuate up and down (noise).	Clogged/dirty junction. Low electrolyte level (refillable pH electrodes only). EC probe sleeve not properly inserted; air bubbles inside sleeve.	Clean the electrode. Refill with fresh solution (refillable pH electrodes only). Properly insert the sleeve. Tap the probe to remove air bubbles.
Out of range in the mV scale.	Dry membrane/dry junction.	Soak in A7071S electrolyte solution for at least one hour.
The meter does not accept the buffer solution for pH calibration.	Out of order pH electrode.	Follow the cleaning procedure. If necessary, replace the electrode.

pH Calibration

Up to 3-point calibration,
5 buffer available (4.01, 6.86, 7.01, 9.18, 10.01 pH)

EC Calibration Offset at 0.00 $\mu\text{S}/\text{cm}$;
Slope at 1 point with 6
memorized values (84.0, 1413 $\mu\text{S}/\text{cm}$;
5.00, 12.88, 80.0, 111.8 mS/cm) or with custom value

Temperature Automatic or manual
Compensation -9.9 to
120.0°C (pH range) 0.0 to 100.0°C
(EC range)

Temperature 0.00 to 10.00%/°C
Coefficient (EC) (default: 1.90%/°C)

TDS Factor Selectable from 0.40 to 1.00
(default value: 0.50)

pH electrode **A1131B**

EC probe **A76309**

with built-in temperature sensor

Power supply 12 Vdc power adapter

Dimensions 230 x 180 x 50 mm

Weight 1.8 kg

Environment 0 to 50°C
RH max. 95% non-condensing

TECHNICAL DATA

Range	-2.00 to 16.00 pH /-2.000 to 16.000 pH ±699.9 mV / ±2000 mV 0.00 to 19.99 µS/cm; 0.00 to 9.99 ppm 20.0 to 199.9 µS/ cm; 10.0 to 99.9 ppm 200 to 1999 µS/cm; 100 to 999 ppm 2.00 to 19.99 mS/cm; 1.00 to 9.99 ppt 20.0 to 199.9 mS/cm; 10.0 to 99.9 ppt -9.9 to 120.0°C (pH range) 0.0 to 100.0°C (EC range)
Resolution	0.01 pH / 0.001 pH 0.1 mV (±699.9 mV) / 1 mV (±2000 mV) 0.01, 0.1, 1 µS/cm; ppm 0.01, 0.1 mS/cm; ppt 0.1°C
Accuracy (@20°C)	± 0.01 pH / ± 0.002 pH ± 0.2 mV up to ± 699.9 mV ± 1 mV up to ± 2000 mV ± 1% f.s. (EC/TDS) ± 0.5°C
Relative mV offset range	± 2000 mV

The display shows blinking “-2.00 pH” or “16.00 pH” .	pH reading out of range.	Recalibrate the meter. Make sure the sample is within the specified pH range. Check electrolyte level and electrode general state.
The display shows blinking “+/-2000 mV” .	mV reading out of range.	Electrode not connected.
The display shows blinking EC or TDS reading.	EC or TDS reading out of range.	Recalibrate the meter. Make sure the sample is within the specified range and the “lock” key was not pressed.
The meter does not work with temp. probe.	Broken temp. probe.	Replace the temperature probe.
The meter fails to calibrate or gives faulty readings.	Broken electrode.	Replace the electrode.
At start-up all LCD tags fixed.	One key is blocked.	Check the keyboard or contact the vendor.
“Err xx” error message displayed.	Internal error.	Power the meter off and on again. If the error persists, contact the vendor.

ELECTRODES, PROBES AND SOLUTIONS

A1131B	Refillable pH electrode with glass body, tip protection bottle, BNC connector and 1 m cable
A1230B	pH electrode with Epoxy body, tip protection bottle, BNC connector and 1 m cable
A3230B	ORP electrode with Epoxy body, tip protection bottle, BNC connector and 1 m cable
A76309	Conductivity probe with built-in temperature sensor, DIN connector and 1 m cable
A7662	Stainless steel temperature probe with 1 m cable.
A70004P	pH 4.01 buffer, 20 ml sachet, 25 pcs
A70007P	pH 7.01 buffer, 20 ml sachet, 25 pcs
A70010P	pH 10.01 buffer, 20 ml sachet, 25 pcs
A70031P	1413 $\mu\text{S}/\text{cm}$ solution, 20 ml sachet, 25 pcs
A70030P	12.88 mS/cm solution, 20 ml sachet, 25 pcs

This model is supplied complete with:

- **A1131B** refillable pH electrode with glass body, BNC connector and 1 m cable
- **A76309** conductivity probe with built-in temperature sensor and 1 m cable
- **A7662** stainless steel temperature probe, 1 m cable
- pH 4.01 and pH 7.01 calibration buffers (20 ml sachet each)
- EC calibration solutions at 1413 $\mu\text{S}/\text{cm}$ and 12.88 mS/cm (20 ml sachet each)
- Probe holder
- 12 Vdc power adapter
- User manual

INTRODUCTION

AD8000 is a microprocessor-based pH, ORP, conductivity, TDS and temperature bench meter. Relative mV feature is also provided.

The autoranging feature of the EC and TDS ranges automatically sets the instrument to the scale with the highest resolution.

pH measurements are compensated for temperature effect automatically (ATC) using **A7662** temperature probe, while the EC readings can be compensated automatically (ATC) using the conductivity probe with built-in temperature sensor or manually (MTC). It is also possible to disable the temperature compensation and measure the actual conductivity.

The temperature coefficient is user selectable.

The pH calibration can be performed at 1, 2 or 3 points with five memorized buffers (pH 4.01, 6.86, 7.01, 9.18, 10.01).

In addition, **AD8000** is provided with calibration time-out alarm, GLP feature to view last calibration data and automatic HOLD feature to freeze the first stable reading on the LCD.

A7071S

3.5 M KCl + AgCl electrolyte solution for refillable electrodes, 30 ml bottle

WARRANTY

Adwa warrants this product to be free of defects in material and workmanship as stated in the operating manual. If repair or adjustment is necessary and has not been the result of abuse, misuse or improper handling within the warranty period, please contact your dealer or the nearest Adwa Office for the RGA (Return Goods Authorization) number to put on the outside of your package. Warranted service will be made without charge. **The meter is warranted for a period of 2 years, while probes are warranted for 6 months.** The warranty period commences from the original date of sale. Warranty is only valid when the product is used under normal conditions and in accordance with the instruction manual. The warranty is void if the instrument is repaired or serviced by unauthorized personnel, not used in accordance to the instructions, or if non-Adwa accessories such as buffer solutions, probes, etc. are used in conjunction with the meter. Adwa will not be held responsible for any accident whether directly or indirectly, caused by the use of this instrument.

TABLE OF CONTENTS

Introduction	4
Technical Data	6
Front and Rear Panels	8
Operational Guide	10
Autoranging	20
pH Calibration	21
Relative mV Calibration	28
EC Calibration	29
Good Laboratory Practice	34
Setup	44
Hold Function	50
Probe Maintenance	51
Troubleshooting Guide	54
Electrodes, Probes and Solutions	56
Warranty	58


Dear Customer,

Thank you for choosing an Adwa product.

Please read carefully this manual before starting operations.

This instrument is in compliance with the EMC Directive 89/336/EEC and Low Voltage Directive 73/23/EEC for electrical equipments.

For additional technical information, please e-mail us at **sales@adwainstruments.com**.

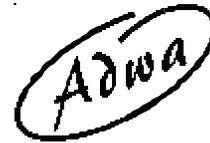

USER MANUAL

**AD8000
pH/mV/EC/TDS/Temperature
Bench Meter**

ADWA INSTRUMENTS Kft.
Alsóikikötő sor 11, 6726 Szeged, Hungary
Tel. +36 62 317 878
Fax +36 62 550 610
e-mail: sales@adwainstruments.com
www.adwainstruments.com

